












Date: Thursday, 5/10/2007 2:15:24 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 206 A/B HIGH GEAR SKIDTUBE
Job Number : 32258	
Estimate Number : 10170	
P.O. Number : N/A	Part Number : D206642212
This Issue : 5/10/2007 S.O. No. : N/A	Drawing Number : N/A
Prsht Rev. : NC	Project Number : N/A
First Issue : N/A	Drawing Revision : N/A
Previous Run : 32257	Material : N/A
Written By : <u>Amos.10</u>	Due Date : 6/6/2007 Qty: 1 Um: Each
Checked & Approved By : <u>Amos.10</u>	
Comment : Est Rev:K 05.07.14 ECN 847 & 901; Add Tow Ring and GHW Kit KJ/CP/JLM	
Additional Product	
Job Number: 	
Seq. #:	Machine Or Operation: Description :
1.0	DC DOCUMENT CONTROL
	  KS 070523 (1)
Comment: DOCUMENT CONTROL Photocopy bluefile & type labels per PPP206-642-212 CHG004 En 07/08/23	
2.0	32258A HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
	 
Comment: Sub-Component HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B D206-642-241 B 32258A	
3.0	PACKAGING 1 PACKAGING RESOURCE #1
	 
Comment: PACKAGING RESOURCE #1 Pick Packing Kit	
4.0	D206651041 206 A/B GHW Kit
	 
Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s) Pick: Packing Kit Qty Part Number Description Batch 1 D206-651-041 GHW Kit 1330235 SP 1 D206-642-241(REF) N/A	
5.0	D2652 Bushing
	 
Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s) Pick: Packing Kit Qty Part Number Description Batch 16 D2652 Bushing 1330234 1/8/23 SP	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:15:24 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32258

Part Number: D206642212

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2655

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2655

Tow Ring

B32280, SQ

7.0

D26652

Saddle, RH, Fwd, Aft, Out



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 D2665-2

Saddle

B28255, SP 29719,

8.0

D26662

Saddle, RH, Fwd, Aft, In



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 D2666-2

Saddle

28604, SQ

9.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

10 D2712

Set Screw

B33667, B.D

10.0

D2884

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

2 D2884

SADDLE SPACER

B29453, 7

11.0

D2885

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Saddle Spacer

B22626, 7/8/23 SQ

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:15:24 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32258

Part Number: D206642212

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

AN341A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN3-41A

Bolt

M104625

S9

13.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 AN4-5A

Bolt

M100857

S0

14.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 AN4-6A

Bolt

M105052

S9

15.0

AN57A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-7A

Bolt

M104374

M104603

S9

16.0

AN511A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-11A

Bolt

M104744

S0

17.0

AN644A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 AN6-44A

Bolt

M102079

7/8/23

S0

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:15:24 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32258

Part Number: D206642212

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

AN960JD10

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD10

Washer M104885

SC

19.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

25 AN960JD416

Washer M104215

SC

20.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD516

Washer M104154

SC

21.0

AN960JD616

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN960JD616

Washer M104374

SC

22.0

MS21042L3

Nut



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 MS21042L3

Nut (or -3) M104936

SC

23.0

MS21042L4

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

M103914, 7/8/23 SC

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: PD Date: 21/08/24
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:15:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32258

Part Number: D206642212

Job Number:



Seq. #:

Machine Or Operation:

Description :

12 MS21042L4 Nut (or -4) _____

24.0

MS21042L6

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 MS21042L6 Nut (or -6) MID1660

1/8/23 SP

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

End 10/23 (x1)

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-212

Location: _____

PPP Rev: _____

CP 10/7/08/23 @ SP

27.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

10/8/24

Job Completion



11 Oct. 24

32258A

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
 Job Number : 32258A
 Estimate Number : 10163
 P.O. Number : N/A Part Number : D206642241
 This Issue : 5/10/2007 S.O. No. : N/A Drawing Number : D2650 REV E P1,3
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : E
 Previous Run : 32257A Material : N/A
 Written By : Due Date : 6/6/2007 Qty: 1 Um: Each
 Checked & Approved By : *[Signature]*
 Comment : Est Rev:M 04.12.02 Revised procedural steps KJ/JLM

Additional Product

Job Number:



Seq. # Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-241 CHG003

NAC

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2620 Bent Tube 3" OD

B31487

BE 07-05-17

3.0 D32861 Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1 Doubler

B33022

A 7-7-31

4.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2647 Fwd Cap

B29328

BE 07-05-17

5.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

BE 07-05-17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

BE 07-05-17

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

AVR Aluminum Rod m102421
m103794

BE 07-05-17

4-Grind weld flush to cap on top surface only.

BE 07-05-17

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

BE 07-07-24

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

fw 07-07-24

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

fw 07-07-24

8-Drill pilot holes using Dt 8167.

fw 07-07-24

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

14-Remove indexing edge using DT8741 as per Dwg D2650

15-C'sink GHW rivet holes as per Dwg D2650

DP
7-7-31

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

Er 07/08/07

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

BE 07-08-01

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

JP 7-8-1

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 07-8-1

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

BE 07-8-1

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

EP 07/08/01 (41)

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number

Description Batch

52 CR3212-4-04

Rivet

M104885

BE 07-08-01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2654-3

Web

B32622 BE 07-08-01

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 07-08-01

Time: 2:00

Finish Date: 07-08-02

Time: 1:00

BE 07-08-01

Pick:

Qty Part Number

Description Batch

A/R Sikaflex-291

Sikaflex expire date:

m104989
01/2008

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Er 07-08-02

All pins go through and align

16.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description Batch

18 D2649

Crossbolt spacer

B31926 BE 07-08-02

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D3286-3

Spacer

B32515 BE 07-08-07

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod

M 104221 BE 07-08-02

2-Grind welds flush as per Dwg D2650

M 07-08-01

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod

NONE BE 07-08-07

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr

M 07-08-02

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets

M 103525

CP 07/08/07

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets

M 102515

M 07-08-01

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch


 
 

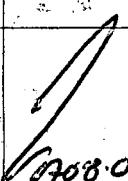
1 D2680-041 Nut Plate

M 28935

CP 07/08/07

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: D Date: 07/08/24
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07/08/07	#18.4	13 th hole from the left end of the tube the centre box is bored out one side of the cross bolt spacer D.C Pilot bore of centre hole		- Remove the x-bolt spacer replace B 31926 - weld x-bolt spacer into place per Eng: QS/004. - grind flush: deburr/above.	 07-08-08  07-08-09	En 07/08/07 En 07/08/09	 07-08-07	 07-08-07

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Ph 0708-020

Install D2680-041 Nut Plate as per Dwg D2650

23.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/08/10

24.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Er 07/08/13 (41)

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

m-h

07/08/15

(IX)

26.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

BK / m-h

07-08-15

(7)

27.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 07/08/15 (1)

28.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

B31695

FL

29.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

B33419

FL 07/08/16 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-21

Wearshoe

B29188

FL

31.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-33

Wearshoe

B32281

FL

32.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad

B31037

FL

33.0

ALS41032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description Batch

44 ALS4-1032-130 Inserts

or (see QSI 017)

M102479

FL

34.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description Batch

44 AN960JD10L

Washer

M104885

FL 07/08/16 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

MS27039108

Screw



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 MS27039-1-08

Screw

m104603

FL

36.0

D26511

Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-1

Plugs

031788

FL

37.0

D26513

O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-3

O-Rings

132099

FL

38.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 MS27039-4-06

Screw m15194

FL

39.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 AN960JD416

Washer

m103338

FL

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

m104989

FL 07/08/16 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/10/2007 2:16:17 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

Sikaflex expire date: 08-01

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

FL

41.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D2646 Aft Cap D31335

FL

42.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 MS27039-1-08 Screw m104603

FL

43.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 AN960JD10L Washer m104885

FL

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive
A/R Sikaflex-291 m104989
Sikaflex expire date: 08-01

> FL 07/08/16 ①

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4
Batch: m104942

FL 07/08/16 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: D Date: 01/08/24
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: - Thursday, 5/10/2007 2:16:17 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32258A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

45.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

En 07/08/16 (XV)

46.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

En 07/08/16 (XV)

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location:

PPP Rev:

000 32258

07/08/23 @ 50

48.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07/08/24

Job Completion



07-08-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN <i>CP</i>	DRAWN BY <i>CP</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED
16 04 17 *PH*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET



NOTES

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG CW D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. **32258A**

Copyright © 1997 by DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

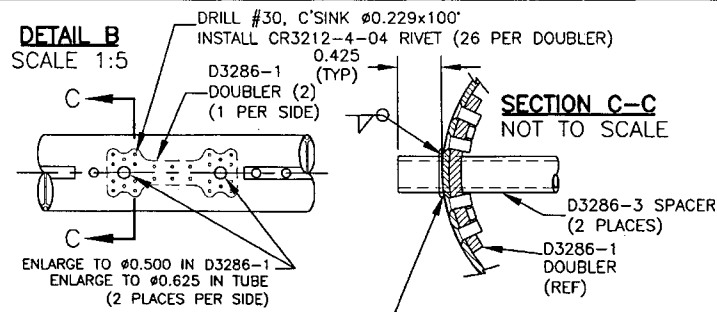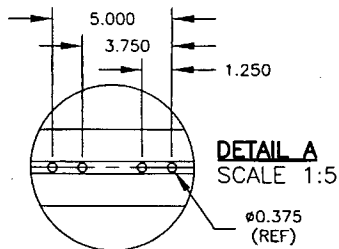

- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO $\phi 0.500$
 4. ENLARGE HOLES IN TUBE TO $\phi 0.625$ AND CHAMFER HOLE $0.030 \times 45^\circ$
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

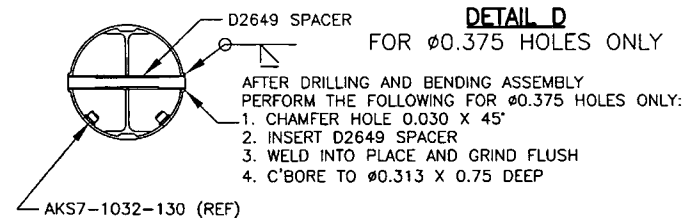


RELEASED
06-04-17

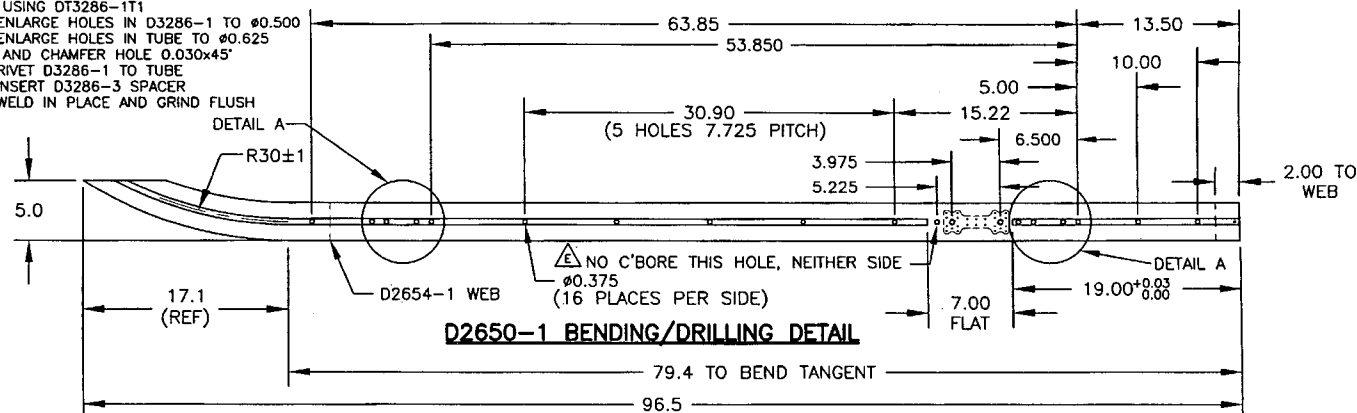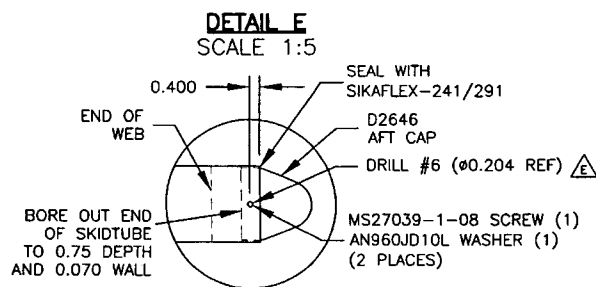


DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

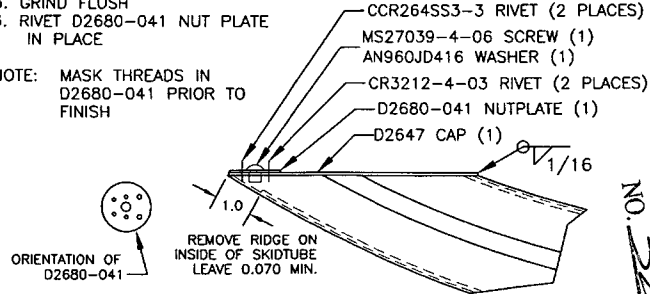

NO. 3228A
WORK ORDER
UNCONTROLLED COPY
RETURN TO
ENGINEERING
SUBJECT TO ATTENDMENT
WITHOUT NOTICE



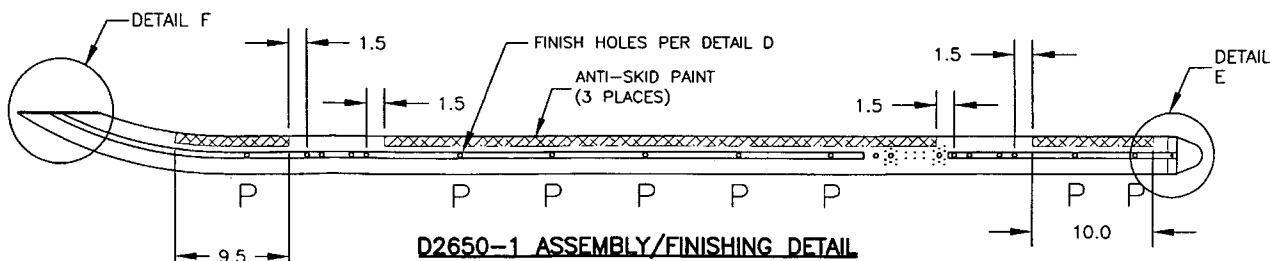


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	PH	DRAWN BY	PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. E
CHECKED	PH	APPROVED	PH	DRAWING NO. D2650	SHEET 2 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32258A

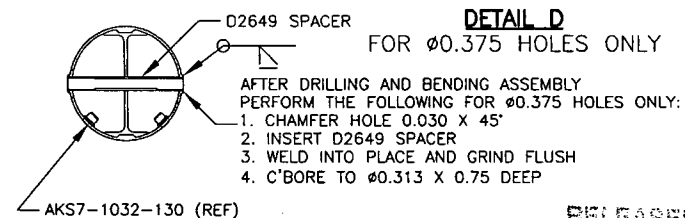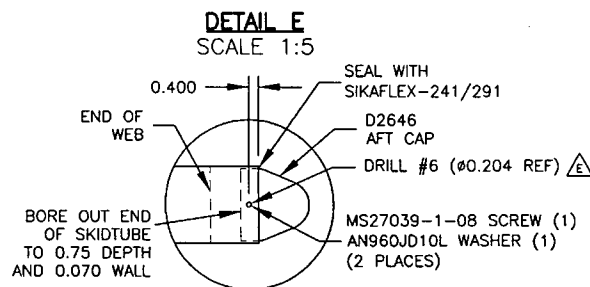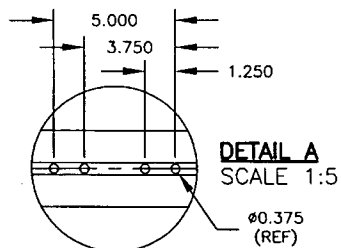


RELEASED

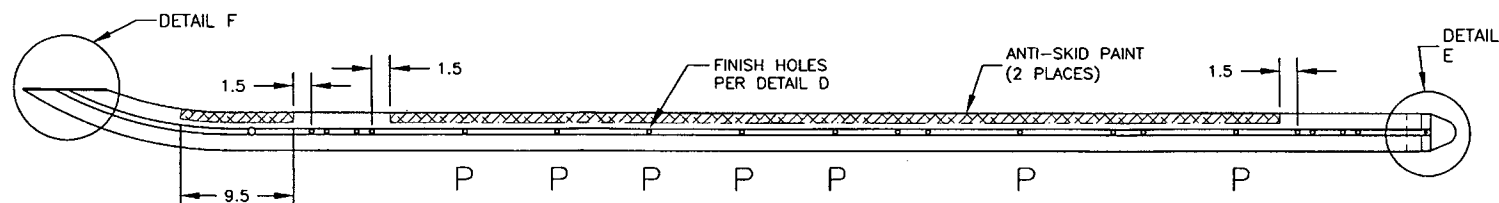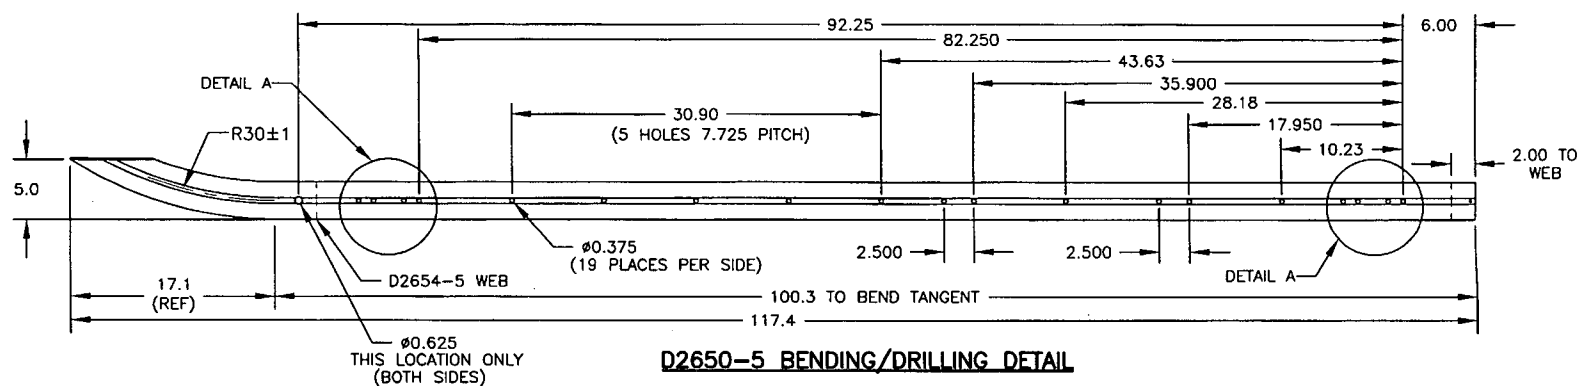

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH




REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

NO. 22587
WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	41	DRAWN BY	41	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	PH	APPROVED	41	DRAWING NO. D2650
DATE	06.03.30	TITLE	SKIDTUBE	REV. E SHEET 4 OF 5 SCALE 1:10

DESIGN	<i>CP</i>	DRAWN BY	<i>CP</i>	 DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	<i>HH</i>	APPROVED	<i>CH</i>	
DATE		DRAWING NO.		REV. E
06.03.30		02650		SHEET 5 OF 5
		TITLE		SCALE
		SKIDTUBE		1:10

NO. 122

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A206642541 / B33624A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/08/08

Qualifier Amel Amel